measure. analyze. innovate.

Piezotron® Coupler

Type 5114...

Versatile Voltage Mode Piezoelectric Sensor Power Supply/Coupler

A self contained power source that provides excitation power and acts as an interface between voltage mode piezoelectric sensors and measuring instruments. Single channel unit powered by internal 9 volt battery or an AC/DC adaptor.

- Provides constant current excitation
- · Monitors condition of sensors and cables
- 3,5 digit LCD display
- · AC, DC or battery powered
- Conforming to CE

Description

Type 5114 is a single channel signal conditioner that provides constant current excitation required by low impedance voltage mode sensors with built-in electronics (i.e. Piezotron, PiezoBeam®, K-Shear®, and Ceramic Shear) or for high impedance sensors with an external impedance converter. Sensor power is supplied by the same two-wire cable that provides the low impedance, output signal. Type 5114 decouples the DC bias voltage from the output signal.


A 3,5 digit LCD with 0,5 inch high digits indicates sensor DC bias voltage. Three light-emitting diode on the display panel indicate the basic status of the sensor circuit. Bias voltages in the range of 4 to 16 volts are normal and result in a "Normal" (green) indication; bias voltages below 4 volts (see model exception note 2) produce a "Short" (red) indication; and, a voltage above 16 volts will result in an "Open" (yellow) indication.

The unit operates from a single 9 volt battery or DC power from an external AC/DC power adapter. "LOBAT" is indicated on the LCD readout when battery replacement is required. One 9 volt battery is installed in a compartment in the bottom of the case and operates 36 hours. The meter will operate at least one hour when displaying "LOBAT". Type 5114 can also be powered by external 12 volt DC power supplied through the 2,1 mm jack. A power "On/Off" switch is located on front of the case.

Application

The primary use for Type 5114 is to provide excitation power low impedance, voltage mode piezoelectric pressure, force and acceleration sensors. Its small size and light weight plastic molded case provides excellent portability for a measurement system both in the laboratory or in the field.



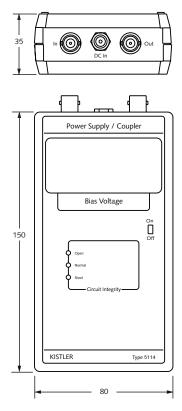

Page 1/2

Kistler Instrument Corporation reserves the right to discontinue or change specifications, designs or materials without notice consistent with sound engineering principles and quality practices.

© 2009, Kistler Instrument Corporation, 75 John Glenn Dr., Amherst, NY 14228 Tel 716-691-5100. Fax 716-691-5226. sales.us@kistler.com. www.kistler.com



measure. analyze. innovate.

Type

Techr	nical	Data

Specification	Unit	Type 5114
Sensor		
Signal voltage	Vpp	20
Supply current	mA	2
Gain		1
Frequency response ¹⁾ (±5%)	Hz	0,07 60 000
(1 M Load; 9.5 ft. total cable		
length and 5Vpp signal level)		
Time constant	S	10
Temperature range operating	°C	-10 55
(alkaline battery)		
Temperature range storage	°C	-20 60

Output

Voltage	Vpp	20	
Impedance	Ω	<100	
		(in series w/47 μF)	
Internal battery	Туре	9 V alkaline	
Battery life	hours	36	
External voltage source	VDC	12 24	
	mA	20	

Connectors

Input/output	Туре	BNC neg.	
External power	Type	2,1 mm jack	
Weight (with battery)	grams	250	

- 1 g = 9,80665 m/s², 1 Inch = 25,4 mm, 1 Gramm = 0,03527 oz, 1 lbf-in = 0,113 Nm
- 1) Actual responses is dependent upon cable length and signal amplitude
- 2) Accelerometer Types 8614A500 and 8694M1 have a normal operating bias on the range of 2,5 to 5 VDC $\,$

Optional Accessories

• AC-DC power adapter (120 V, 60 Hz) 5752
• AC-DC power adapter 5757
(230 V, 50 Hz, CE certified)
• Protective rubber boot 3.750.067
• Alkaline battery, 9 V 300-0092-003
• Carrying case 605-2501-01
• DC power cable (6 ft) 704-2068-00

Ordering Key

Ordering Key	Type 5114	
Power supply/coupler - variants		Ī
Supplied with 9V alkaline battery	_	
Supplied with 9V alkaline battery AC-DC power adapter (5752), and carrying case (605-2501-001)	S1	

Measure	Connect	Amplify	Output	Analyze
			图》	=
Type 87XX	Type 1761B	Type 5114	Type 1511	
Low impedance	10-32 pos BNC pos.	Power supply / signal conditioner	BNC pos. BNC pos.	not supplied

Fig. 1: Measuring chain